


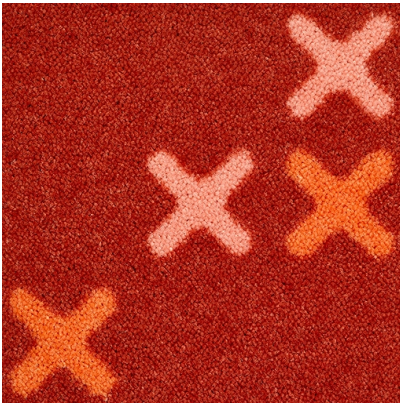

## EXPLAIN CROSS STITCH TT 1217-Lo2 | CARPET TILE 48 X 48 CM

### GENERAL

For processing the Explain Cross Stitch TT the VOB (Verdingungsordnung für Bauleistungen – conditions for the execution of works), part C, DIN 18365 (Germany) respectively the applicable standards for “flooring works”, the generally recognized technical rules as well as state need to be taken into account.

Determining for the optimal usage strength and wear resistance as well as the value retention of the Explain Cross Stitch tiles are the preparations of the subfloor and the processing of the tools and flooring. The manufacturers of tools provide extensive information about primers, equalizers and glues. Their processing guidelines must be followed. There can only be used product system from **one and the same manufacturer**.

Despite regular quality inspections, material errors cannot be ruled out. That's why the carpet tiles must be inspected on equal production number, conformity with the material of the sample and on errors, before starting the cutting and instalment. **Visual errors cannot be acknowledged anymore after installation and cutting to size of the material.**

### INSPECTION AND PREPARATION OF THE SUBFLOOR

The inspection must be checked and prepared according to the VOB, part C, DIN 18365 (Germany) respectively the recognized standard for “flooring works” the general acknowledged technical terms as well as state of technics. They must be among others free of cracks, clean, free of dirt, free of grease, pull and pressure resistant and sustainably dry. Be aware of the allowed residual humidity and potentially rising damp depending on the type of construction.

Equalized and flat subfloors are necessary for a good result of the flooring works.

For floor heating applies next to DIN 18365 also DIN 4725 “heated finishing floors”. The temperature cannot exceed 27°C on the surface of the finishing floor.

### LAYING OF EXPLAIN CROSS STITCH TT

The laying is also done following VOB, deel C, DIN 18365 (Duitsland), being the applicable standards for “flooring works”, the generally recognized technical rules as well as state

The requirements regarding the inner climate conform DIN 18365 must absolutely be met: a flowing temperature of

#### LEOXX B.V.

Sasdijk 14, 8281 BM Genemuiden (NL)

T +31 30 635 10 00 | E info@leox.com | I www.leox.com

IBAN NL87 RABO 0305 9745 13 | KvK 30151348 | BTW NL807305157B01

at least 15°C, a room air temperature of at least 18°C and a relative air humidity of maximum 70%.

Let the flooring and tools acclimatize 24 hours before instalment.

#### ANTI-SLIP

Tiles must be placed in anti-slip coating. Ask your glue manufacturer about which glue is best to use, based on the backing of the floor covering and support concerned.

#### PROCESSING

The Easy lift backing is a felt backing, making it not slide on an anti-slip layer. That's why the tile needs to be laid 'fluently': work from a corner and fluently turn the tile against the previous tile. Important: the processor (or installer) needs to work and look 'against' the direction of the poles during the instalment. This way it's prevented pole material ends up between the tiles. It is also possible to slide a rubber or PVC tile of the size of the tile for  $\frac{3}{4}$  underneath the Explain Cross Stitch tile. If you take both tiles they can be slid across the anti-slip coating.

To prevent cutting loss it is advised to measure the to be covered surface and distribute the material matching the size. Afterwards a tail line is applied in the length hand width matching this distribution.

#### LAYING DIRECTION

legrichting 1 richting 1.png

One direction

#### MAINTENANCE ADVICE

We advise to properly clean the carpet tiles after instalment with a brush vacuum cleaner with a mechanically driven brush. This removes the dirt created during the construction and prevents it to cause stains later on. Daily vacuuming with a vacuum cleaner equipped with a rotating brush. Most stains can be removed with the Spotter of Duofort. For periodical maintenance the bonnet, powder or spray-extraction method is advised.

#### LAYING DIRECTION

#### LEOXX B.V.

Sasdijk 14, 8281 BM Genemuiden (NL)

T +31 30 635 10 00 | E info@leox.com | I www.leox.com

IBAN NL87 RABO 0305 9745 13 | KvK 30151348 | BTW NL807305157B01



Monolithic



[View product](#)